
FC12QE, FC16QE, FC24QE Procedure / How to Joint Carrie Tapes 1. Cut the end of the carrier tape on the feeder side. (Carrier tape A) 5. Stick the carrier tapes which caulked to the end of a positioning guide. In case of splicing carrier tapes by only joint tape, See Remarks In Chip parts of carrier tape A Positioning guide Empty Part of Carrier tape Cut the center of cavity, together with cover tape 2. Cut the front of a new carrier tape. (Carrier tape B) 6. Bend the Joint Tape along a bending line and stick it on feeding holes Cut the center of cavity, together with cover tape A Positioning guide Cut the cover tape leaving Bend the joint tape its end about 2mm~4mm with transparent tape

3. Caulk Tape A and Tape B with a metal plate. (Ref. Procedure of Caulking)

In case of splicing carrier tapes by only joint tape, See Remarks.

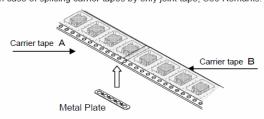

4. Peel a white cover of the joint tape up to a positioning guide



All Completed.

**Be sure a black tape sticks completely to the carrier tape. Feed direction


7. Peel a positioning guide and a transparent tape

Remarks:

Procedure splicing without Metal Plate

At first, Set a Carrier tape A on a positioning guide, and stick the cover tape downward on the center of Joint Tape.

And then, stick a carrier tape B setting it on a positioning guide and setting its cut end on a carrier tape A.

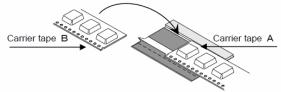

Mid America (UK) Ltd

Hill House, Rockfield, Tain, IV20 1RF, Scotland

Tel: 44 1862 871 555 Fax: 44 1862 871 666 email: mauk@btconnect.com

www.mauksmt.com

